

# TECHNICAL BULLETIN



*MODEL/DERIVATIVE:*  
**Discovery Series II (LT)  
Defender (LD)**

*Bulletin N°:* **0009**  
*CDS. ref:* **L8817bu**  
*Issue:* **1**  
*Date:* **28.08.02**

*AFFECTED RANGE:*  
**All Td5 manual derivatives from the following VINs:  
Discovery Series II - 3A 782113  
Defender - 2A 642885**

*PROBLEM:*  
**DOWNLOADING SOFTWARE TO THE ENGINE CONTROL MODULE (ECM)  
INTRODUCES DRIVEABILITY PROBLEMS**

*CAUSE:*  
**The ECM software on vehicles from the above VINs supersedes that on  
TestBook/T4 disc DRG016 and earlier.**

*ACTION:*  
**When using TestBook/T4 disc DRG016 or earlier, refuse the option to reprogram the  
ECM on vehicles from the stated VINs. The latest ECM software will be on disc  
DRG017, which will be available shortly.**

*PARTS INFORMATION:*  
**Not applicable.**

*WARRANTY CLAIMS:*  
**Not applicable.**